

Service Bulletin



To: Notified Customers

Bulletin Number: **SB 22-0015-MH-1MBTU**

Date Of Notice: 10/18/22

Subject: Maxi Heat T-Map sensor relocation

Product Line: Maxi Heat 1MBTU

Model: Heater

Serial Numbers: 36-000001 through 36-000652

Expiration Date: No Expiration

Critical Correction - Action & Response Required Immediately	<input type="checkbox"/>
Action Required - Fix, No Report	<input type="checkbox"/>
If Encountered - Correct If Issue is Found	<input type="checkbox"/>
Information Only	<input checked="" type="checkbox"/>

Authorized Labor Charges For This Bulletin:
No labor & No parts

Part Numbers Required To Correct This Bulletin:
Kit Part Number 124435

Description or Summary of Improvement:

The T-Map sensor has been relocated to the bottom of the control panel. The original location exposed the sensor to the elements and made it easier for debris to accumulate inside the tip of the sensor. If the T-Map is covered with dust or dirt it can miscalculate the air band adjustment. Incorrect air band adjustments can compromise the air to fuel ratio of the burner. Relocating the sensor helps to extend the life of the T-Map and eliminates buildup of dust or debris.

Correction and Instructions:

Relocate the T-Map sensor from the original location to the new designated area. Kit 124435 will provide the parts and instructions for the update of the T-Map. Page 2 provides an example of the original location and the new location of the sensor. Units with T-Map's in the original location will operate and work correctly; the kit is an optional upgrade.

**CONTACT INFORMATION: FOR ADDITIONAL CLARIFICATION OR FURTHER INSTRUCTIONS, PLEASE CONTACT THE FOLLOWING:
ALLMAND SERVICE TEAM AT (308) 995-3431**


Service Bulletin



SB 22-0015-MH 1MBTU T-Map Sensor Relocation

Example A: The sensor was mounted to the top side of the rear quarter panel above the control panel. If your unit has the sensor in this location you can use kit 124435 to complete the update.

Example B: The new location of the T-Map is underneath the main breaker box. The sensor will mount to a new bracket that comes in kit 124435

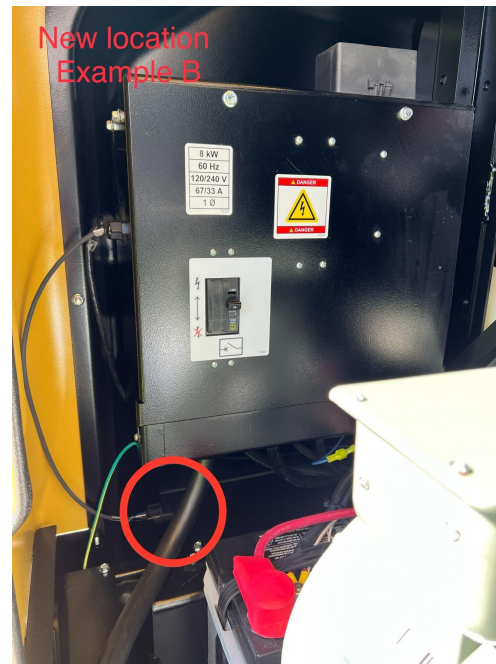

Service Bulletin



SB 22-0015-MH 1MBTU T-Map Sensor Relocation

Step 3:

Included in Kit: